

Software Name: Firmware for EDS-828 Series

| Version No. | Build Date No./ Release Date | Supported OS | Apply to Models                               | New Features/ Enhancements  | Bugs Fixed/Changes   | Note  |
|-------------|------------------------------|--------------|---|---|--|---|
| v3.8        | Build_17041116               | N/A          | EDS-82810G, EDS-82810G-4GTX, EDS-82810G-4GSFP | <p><b>New Features:</b><br/>N/A</p> <p><b>Enhancements:</b></p> <ol style="list-style-type: none"> <li>1. Added warning message when default password was not changed.</li> <li>2. Encrypted security keys in user interface.</li> <li>3. Enhanced RSTP compatibility.</li> </ol> | <p><b>Bugs Fixed:</b></p> <ol style="list-style-type: none"> <li>1. Cross-site scripting vulnerability.</li> <li>2. Denial of Service attack vulnerability.</li> <li>3. Privilege escalation vulnerability.</li> <li>4. SSL v2/v3 vulnerability in HTTPS.</li> <li>5. Web console cannot be accessed due to SNMP get bulk.</li> <li>6. Specific CLI command cause switch reboot with default settings.</li> <li>7. Add a new VLAN will change IGMP querier state from disable to enable.</li> <li>8. Can not save configurations to the ABC-01 via IE browser.</li> <li>9. Rate limit could not be set in web UI.</li> <li>10. PTP timestamp error in announce Message.</li> <li>11. Telnet hangs after SSH disabled.</li> <li>12. Corrected RSTP edge definition in exported configuration file.</li> <li>13. Corrected authorization of Radius/TACACS+ login.</li> <li>14. Display issue with JAVA applet.</li> <li>15. Corrected RSTP Auto-Edge behavior.</li> <li>16. System rebooted after specific CLI command.</li> </ol> <p><b>Changes:</b></p> <ol style="list-style-type: none"> <li>1. The following feature settings were removed from the menu mode console due to flash size limitations. However, users can also set up via web UI and CLI.</li> <li>2. SW PTP.</li> <li>3. IP filter.</li> <li>4. Line Swap.</li> <li>5. Traffic prioritization.</li> <li>6. SNMP setting.</li> <li>7. Port Access Control.</li> <li>8. Auto warning.</li> </ol> | <ol style="list-style-type: none"> <li>1. This is the last official firmware update for EDS-828 Series hardware revision v1.x due to flash size limitation. The future official firmware upgrade will only apply to hardware revision v3.0 or later.</li> </ol> |

Software Name: Firmware for EDS-828 Series

| Version No. | Build Date No./ Release Date | Supported OS | Apply to Models                               | New Features/ Enhancements  | Bugs Fixed/Changes  | Note |
|-------------|------------------------------|--------------|---|---|---|------|
| v3.5        | Build_16052318               | N/A          | EDS-82810G, EDS-82810G-4GTX, EDS-82810G-4GSFP | <p><b>New Features:</b><br/>N/A</p> <p><b>Enhancements:</b><br/>N/A</p>   | <p><b>Bugs Fixed:</b></p> <ol style="list-style-type: none"> <li>1. Incorrect system time.</li> <li>2. IGMP forwarding multicast traffic caused an exception when IGMP was disabled in the management VLAN.</li> <li>3. OSPF-enabled L3 switches unexpectedly rebooted at the same time.</li> </ol> <p><b>Changes:</b><br/>N/A</p>  | N/A  |
| v3.4        | Build_15011510               | N/A          | EDS-82810G, EDS-82810G-4GTX, EDS-82810G-4GSFP | <p><b>New Features:</b><br/>N/A</p> <p><b>Enhancements:</b><br/>N/A</p>   | <p><b>Bugs Fixed:</b></p> <ol style="list-style-type: none"> <li>1. Web user interface display errors under Java 8 environments.</li> </ol> <p><b>Changes:</b><br/>N/A</p>  | N/A  |
| v3.3        | N/A                          | N/A          | EDS-82810G, EDS-82810G-4GTX, EDS-82810G-4GSFP | <p><b>New Features:</b><br/>N/A</p> <p><b>Enhancements:</b></p> <ol style="list-style-type: none"> <li>1. Added web interface for loop-protection enable/disable.</li> <li>2. Added web interface for SSH/SSL key generation.</li> <li>3. Added SNMP MIB for SFP DDM (Diagnostics).</li> <li>4. Added web interface/CLI/SNMP for NTP/SNTP client settings.</li> </ol> | <p><b>Bugs Fixed:</b></p> <ol style="list-style-type: none"> <li>1. Login failed in CLI mode when the password contained a special character.</li> <li>2. Login authentication failed if the radius server did not support privilege levels assignment.</li> <li>3. Access Control List (ACL) did not function correctly.</li> <li>4. IEEE 1588 PTP did not function correctly.</li> <li>5. SFP DDM (Diagnostics) display inaccurate values.</li> <li>6. Configuration import was restricted if the system name was too long.</li> <li>7. Devices were sometimes unreachable across different subnets through the switch.</li> <li>8. Hybrid VLAN lacks of SNMP MIB object.</li> </ol> <p><b>Changes:</b><br/>N/A</p> | N/A  |

## Software Name: Firmware for EDS-828 Series

| Version No. | Build Date No./ Release Date | Supported OS | Apply to Models                               | New Features/ Enhancements  | Bugs Fixed/Changes   | Note |
|-------------|------------------------------|--------------|---|---|--|------|
| v3.1        | N/A                          | N/A          | EDS-82810G, EDS-82810G-4GTX, EDS-82810G-4GSFP | <b>New Features:</b><br>N/A<br><br><b>Enhancements:</b><br>1. Passed ODVA EtherNet/IP certificate.<br>2. Added some minor SNMP OIDs.<br>3. Enhanced multicast performance.<br>4. Added version number in MIB file.  | <b>Bugs Fixed:</b><br>1. NTP did not synchronize time in default settings.<br>2. NTP client function did not work with Windows XP NTP server.<br>3. Firmware Upgrade Failed when IEEE 802.1x was enabled.<br>4. The switch rebooted when receiving IGMP v3 packets (commonly used in Windows 7).<br><br><b>Changes:</b><br>N/A | N/A  |
| v2.7        | N/A                          | N/A          | EDS-82810G, EDS-82810G-4GTX, EDS-82810G-4GSFP | <b>New Features:</b><br>1. Added new internal algorithm to prevent system hang when a layer 3 interface was changed due to link up and down and also received a lot of unknown packets at a rate greater than 50 Mbps.<br>2. Added new internal algorithm to prevent system from generating incorrect layer 3 routing table when an Ethernet switch port abnormally links up/down.<br><br><b>Enhancements:</b><br>N/A | <b>Bugs Fixed:</b><br>1. Turbo Ring V2 recovery issue when Gigabit Fiber port abnormally links up/down.<br><br><b>Changes:</b><br>N/A  | N/A  |
| v2.6        | N/A                          | N/A          | EDS-82810G, EDS-82810G-4GTX, EDS-82810G-4GSFP | <b>New Features:</b><br>1. Added OSPF and VRRP function.<br>2. Supports TurboPack™ 2009 (add new functions for Turbo Chain, IPv6, Modbus/TCP, IEEE 1588 PTP, SNMP Inform, LLDP, DHCP Option 82, Firefox, and SSH).<br><br><b>Enhancements:</b><br>N/A   | <b>Bugs Fixed:</b><br>N/A<br><br><b>Changes:</b><br>N/A  | N/A  |

**Software Name:** Firmware for EDS-828 Series

| Version No. | Build Date No./ Release Date | Supported OS | Apply to Models                               | New Features/ Enhancements  | Bugs Fixed/Changes                                      | Note |
|-------------|------------------------------|--------------|---|---|---|------|
| v1.1        | N/A                          | N/A          | EDS-82810G, EDS-82810G-4GTX, EDS-82810G-4GSFP | <b>New Features:</b><br>1. New release for EDS-828 Series.<br><br><b>Enhancements:</b><br>N/A | <b>Bugs Fixed:</b><br>N/A<br><br><b>Changes:</b><br>N/A | N/A  |