

| | | Column Hamel Labo and Finnish Laboratory | | | | | |
|-------------|---------------------------------|--|-----------------|---|--|--|--|
| Version No. | Build Date No./ Release Date | Supported OS | Apply to Models | New Features/Enhancements | Bugs Fixed/Changes | Note | |
| 3.8 | Build_17041116 | N/A | EDS-828 | New Features: N/A Enhancements: 1. Add warning message when default password was not changed 2. Encrypt security Keys in user interface 3. Enhance RSTP compatibility | Bugs Fixed: 1. Cross-site scripting vulnerability 2. Denial of Service attack vulnerability 3. Privilege escalation vulnerability 4. SSL v2/v3 vulnerability in https 5. Web console cannot be accessed due to SNMP get bulk 6. Specific CLI command cause switch reboot with default settings 7. Add a new VLAN will change IGMP querier state from disable to enable. 8. Saving configuration to ABC-01 cannot be performed via IE browser 9. Rate limit cannot be set in web UI 10. PTP timestamp error in announce Message 11. Telnet hangs after SSH disabled 12. Correct RSTP edge definition in exported configuration file 13. Correct authorization of Radius/TACACS+ login 14. Display issue with JAVA applet 15. Correct RSTP Auto-Edge behavior 16. System reboot after specific CLI command Changes: The following feature settings are removed from menu mode console due to flash size limitation However, user can also setup by web UI and CLI. 1. SW PTP 2. IP filter 3. Line Swap 4. Traffic prioritization 5. SNMP setting 6. Port Access Control 7. Auto warning | This is the last official firmware update for EDS-828 hardware revision v1.x due to flash size limitation. The future official firmware upgrade will only apply to hardware revision v3.0 or above | |



| Version No. | Build Date No./ Release Date | Supported OS | Apply to Models | New Features/Enhancements | Bugs Fixed/Changes | Note |
|-------------|---------------------------------|--------------|-----------------|---|--|------|
| 3.5 | Build_16052318 | N/A | EDS-828 | New Features: N/A Enhancements: N/A | Bugs Fixed: 1. Incorrect system time. 2. IGMP forwarding multicast traffic causes an exception when IGMP is disabled in the management VLAN. 3. OSPF-enabled L3 switches unexpectedly reboot at the same time. Changes: N/A | N/A |
| 3.4 | Build_15011510 | N/A | EDS-828 | New Features: N/A Enhancements: N/A | Bugs Fixed: 1. Web user interface display errors under Java 8 environments. Changes: N/A | N/A |
| 3.3 | N/A | N/A | | New Features: N/A Enhancements: 1. Add web interface for loop-protection enable/disable 2. Add web interface for SSH/SSL key generation 3. Add web interface/CLI/SNMP for NTP/SNTP client settings 4. Add SNMP MIB for SFP DDM (Diagnostics) | Bugs Fixed: 1. Login fail in CLI mode when password is with special character. 2. Login authentication failed if the radius server does not support privilege levels assignment. 3. Access Control List (ACL) cannot function correctly. 4. IEEE 1588 PTP cannot function correctly. 5. SFP DDM (Diagnostics) display inaccurate values. 6. Restricts configuration import if the system name is too long. 7. Devices are sometimes unreachable cross different subnets through the switch. 8. Hybrid VLAN lacks of SNMP MIB object. Changes: | N/A |



| | | <u>=====================================</u> | | | | |
|-------------|---------------------------------|--|-----------------|--|---|------|
| Version No. | Build Date No./ Release Date | Supported OS | Apply to Models | New Features/Enhancements | Bugs Fixed/Changes | Note |
| 3.1 | N/A | N/A | EDS-828 | New Features: N/A Enhancements: 1. Pass ODVA EtherNet/IP certificate. 2. Add some minor SNMP OIDs. 3. Enhance multicast performance. 4. Add version number in MIB file. | Bugs Fixed: 1. NTP cannot synchronize time in default setting. 2. NTP client function cannot work with Windows XP NTP server. 3. Firmware Upgrade Failed when IEEE 802.1x is enabled. 4. Switch reboots when receiving IGMP v3 packets (commonly used in Windows 7). Changes: N/A | N/A |
| 2.7 | N/A | N/A | EDS-828 | generating incorrect layer 3 routing table when an Ethernet switch port abnormally links up/down. | Bugs Fixed: 1. Fix bug for Turbo Ring V2 recovery issue when Gigabit Fiber port abnormally links up/down. Changes: N/A | N/A |
| 2.6 | N/A | N/A | EDS-828 | functions of Turbo Chain, Modbus/TCP, IEEE 1588 PTP, SNMP Inform, LLDP, DHCP Option 82, Firefox, | Bugs Fixed: N/A Changes: N/A | N/A |

Form number: PD.450 Version: 1.0 Page 3 of 4



| Versio No. | Build Date No./ Release Date | Supported OS | Apply to Models | New Features/Enhancements | Bugs Fixed/Changes | Note |
|---------------|---------------------------------|--------------|-----------------|---|---------------------------------------|------|
| 1.1 | N/A | N/A | EDS-828 | Newly released for EDS-828 series. Enhancements: | Bugs Fixed: N/A Changes: N/A | N/A |