

Software Name: PT-G7509 Series Firmware

| Version No. | Build Date No./<br>Release Date | Supported OS | Apply to Models | New Features/Enhancements  | Bugs Fixed/Changes  | Note |
|-------------|---------------------------------|--------------|-----------------|--|---|------|
| 3.8         | Build_17041117                  | N/A          |                 | New Features: N/A  Enhancements: 1. Add warning message when default password was not changed 2. Encrypt security keys in user interface 3. Enhance RSTP compatibility | 1. Cross-site scripting vulnerability 2. Denial of service attack vulnerability 3. Privilege escalation vulnerability 4. SSL v2/v3 vulnerability in https 5. Web console cannot be accessed due to SNMP get bulk 6. Specific CLI command cause switch reboot with default settings 7. Add a new VLAN will change IGMP querier state from disable to enable 8. Saving configuration to ABC-01 cannot be performed via IE browser 9. Correct RSTP auto-edge behavior 10. Rate limit cannot be set in web UI 11. PTP timestamp error in announce message 12. System reboot after specific CLI command 13. Display issue with JAVA applet 14. Telnet hangs after SSH disabled 15. Correct RSTP edge definition in exported configuration file 16. Correct authorization of Radius/TACACS+ login  Changes: N/A | N/A  |

Form number: PD.450 Version: 1.0 Page 1 of 3



Software Name: PT-G7509 Series Firmware

|             |                                 | Column Hamel 11 Cross Concernment |                 |  |  |      |
|-------------|---------------------------------|-----------------------------------|-----------------|--|--|------|
| Version No. | Build Date No./<br>Release Date | Supported OS                      | Apply to Models | New Features/Enhancements  | Bugs Fixed/Changes   | Note |
| 3.3         | N/A                             | N/A                               | PT-G7509 Series | New Features:<br>N/A<br>Enhancements:<br>N/A   | Protection function issue  9. Corrected the description of Modbus/TCP in MIB.  10. Fix no Rate Limiting Control Mode settings in exported config file.  11. After CLI config saving, the Rate Limiting setting will become empty  12. Fix Ping fail issue after changing IP continuously.  13. Fix SNMP vlanEntry displays in error characters.  14. Fix CPU loading issue under 256 IGMP ioin packet. | N/A  |
| 3.1         | N/A                             | N/A                               |                 | New Features: N/A  Enhancements: 1. Pass ODVA EtherNet/IP certificate 2. Add some minor SNMP OIDs 3. Enhance multicast performance 4. Add version number in MIB file | Bugs Fixed:  1. NTP cannot synchronize time in default setting  2. NTP client function cannot work with Windows XP NTP server  3. Firmware Upgrade Failed when IEEE 802.1x is enabled  4. Switch reboots when receiving IGMP v3 packets (commonly used in Windows 7)  Changes:  N/A  | N/A  |



Software Name: PT-G7509 Series Firmware

| Version No. | Build Date No./<br>Release Date | Supported OS | Apply to Models | New Features/Enhancements  | Bugs Fixed/Changes                    | Note |
|-------------|---------------------------------|--------------|-----------------|--|---------------------------------------|------|
| 2.6         | N/A                             | N/A          | PT-G7509 Series | N/A  | Bugs Fixed:<br>N/A<br>Changes:<br>N/A | N/A  |
| 1.1         | N/A                             | N/A          | PT-G7509 Series | functions of Turbo Chain, IPv6, Modbus/TCP, IEEE<br>1588 PTP, SNMP Inform, LLDP, DHCP Option 82, | Bugs Fixed:<br>N/A<br>Changes:<br>N/A | N/A  |