

**Software Name:** VPort26A-1MP Series Firmware

| Version No. | Build Date No./ Release Date | Supported OS | Apply to Models  | New Features/Enhancements  | Bugs Fixed/Changes  | Note |
|-------------|------------------------------|--------------|--|--|---|------|
| 2.5         | 18030608                     | N/A          | VPort 26A-1MP<br>VPort 26A-1MP-T<br>VPort P26A-1MP<br>VPort P26A-1MP-T | Enhancement:<br>1. Upgrade the BIOS to V1.1<br>2. Change the serial no. to 12 digits on web console  | N/A   | N/A  |
| 2.4         | 16121618                     | N/A          | VPort 26A-1MP<br>VPort 26A-1MP-T<br>VPort P26A-1MP<br>VPort P26A-1MP-T | New Features:<br>1. Add image sensor de-noise option<br><br>Enhancements:<br>1. Support ONVIF pull point event over HTTPS<br>2. Enhance tamper function design<br>3. Enable network flow control for smooth streaming transmission<br>4. Enhance the image color when in the change of high and low illumination<br>5. The H/W reset will be added into the system log information | Bugs Fixed:<br>1. Fix the issue that there is no 176x122, 1280x 800 resolutions in Genetec v4.8_2520<br>2. Fix the issue that the system may be able to be operated when the SD card mount is failed<br>3. Fix the issue that the SD I/O Error message is appeared after the Factory default<br>4. Fix the issue that the web will be crashed after Nessus scan<br>5. Fix the issue that the tamper alarm will be triggered continually when changing the VPort's resolution.<br>6. Fix the issue that the non-admin account cannot control the DO/Relay<br>7. Fix the issue that the VPort cannot be found when UPnP is reboot<br>8. Fix the issue that the wrong password in ONVIF authentication is still able to use the get/set device command<br>9. Fix the issue that the motion detection function will be crashed when using VPort's | N/A  |

**Software Name:** VPort26A-1MP Series Firmware

| Version No. | Build Date No./ Release Date | Supported OS | Apply to Models  | New Features/Enhancements   | Bugs Fixed/Changes  | Note |
|-------------|------------------------------|--------------|--|---|---|------|
| 2.3         | 15041521                     | N/A          | VPort 26A-1MP<br>VPort 26A-1MP-T<br>VPort P26A-1MP<br>VPort P26A-1MP-T | New Features:<br>N/A<br><br>Enhancements:<br>N/A  | Bugs Fixed:<br>1. Fix the DHCP discovery cannot be resent issue when the network is linked down and linked up.<br>2. Fix unable to mount the SD card automatically issue when processing the unmount manually<br>3. Fix the abnormal issue in turn on/off FTP server when in FTP transmission<br>4. Fix the connection fail issue when there is large multicast packets in the network<br>5. Fix the multicast streaming inwork issue after changing IP address but not to configure the gateway<br>6. Fix the web server creash issue after deleteting the default 3 profiles via CGI commands<br>7. Fix the abnormal operation issue when SD card is plug and unplug<br>8. Fix the issue that the system will not be reboot automatically when the SD card is unplug in recording process<br>9. Fix the connection fail issue when in the Sequential Snapshot mode with complicated image content<br>10. Fix the issue that the camera is not added into camera list of Milestone VMS | N/A  |
| 2.2         | 14052909                     | N/A          | VPort 26A-1MP<br>VPort 26A-1MP-T<br>VPort P26A-1MP<br>VPort P26A-1MP-T | New Features:<br>1. Compliant with ONVIF Profile S spec V2.2.1<br>2. Support Firefox, Chrome browser<br>3. Support HTTP digest authentication<br>4. Support POSIX 1003.1 customized time zone setting<br>5. Add ONVIF device auxiliary commands to support CBRPro<br><br>Enhancements:<br>N/A | Bugs Fixed:<br>N/A<br><br>Changes:<br>1. Restore max UDP connection to 5 by remove private VMD encoder<br>2. Change the MIB file to V2.2  | N/A  |

**Software Name:** VPort26A-1MP Series Firmware

| Version No. | Build Date No./ Release Date | Supported OS | Apply to Models  | New Features/Enhancements   | Bugs Fixed/Changes   | Note |
|-------------|------------------------------|--------------|--|---|--|------|
| 2.0         | 14010310                     | N/A          | VPort 26A-1MP<br>VPort 26A-1MP-T<br>VPort P26A-1MP<br>VPort P26A-1MP-T | New Features:<br>Support ONVIF Profile S<br><br>Enhancements:<br>Web user interface is changed due to support the Profile S | Bugs Fixed:<br>N/A<br><br>Changes:<br>N/A  | N/A  |
| 1.2         | N/A                          | N/A          | VPort 26A-1MP<br>VPort 26A-1MP-T<br>VPort P26A-1MP<br>VPort P26A-1MP-T | New Features:<br>N/A<br><br>Enhancements:<br>Compliance with IE10   | Bugs Fixed:<br>Fix stream server crash (audioTrack/connection) issue<br><br>Changes:<br>Change UI Text: Audio Enable Microphone - > Audio Enable | N/A  |
| 1.1         | N/A                          | N/A          | VPort 26A-1MP<br>VPort 26A-1MP-T<br>VPort P26A-1MP<br>VPort P26A-1MP-T | New Features:<br>Newly released for VPort 26A series<br><br>Enhancements:<br>N/A  | Bugs Fixed:<br>N/A<br><br>Changes:<br>N/A  | N/A  |