

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/Enhancements	Bugs Fixed/Changes	Note
2.5		N/A	VPort P06-1MP-M12 series	New Features: 1. support flow control  Enhancements: 1. Upgrade the BIOS to V1.5 2. Change the serial no. to 12 digits on web consol	Bugs Fixed:  1. Fix the issue that the camera will lose configuration occasionally  Changes: N/A	N/A
2.4	Build 16032502	N/A	VPort P06-1MP-M12 series	New Features: N/A Enhancements: N/A	Bugs Fixed: N/A Changes: 1. Use in house designed tamper V2.0. 2. Update to ActiveX SDK 2.8	N/A
2.3	Build 15041522	N/A	VPort P06-1MP-M12 series	New Features: N/A Enhancements: N/A	Bugs Fixed:  1.Fix the connection fail issue when there is large multicast packets in the netowork  2.Fix the multicast streaming inwork issue after changing IP address but not to configure the gateway  3. Fix the web server creash issue after deleteting the default 3 profiles via CGI commands  4. Fix the connection fail issue when in the Sequential Snapshot mode with complicated image content  5. Fix the issue that unable to provide correct audio stream when doing the MJPEG video record with MXNVR-IA8  6.Fix the issue that the stream server crash may be happened when connecting to the caqmera under the booting process  7.Fix the configuration import fail issiue when the camera's network connection is in	None



Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/Enhancements	Bugs Fixed/Changes	Note
2.2	Build 14052816	N/A	VPort P06-1MP-M12 series	<ul><li>3. Support Firefox, Chrome browser</li><li>4. Support HTTP digest authentication</li><li>5. Support POSIX 1003.1 customized time zone setting</li><li>6. Add ONVIF device auxiliary commands to support CBRPro</li></ul>	Bugs Fixed: N/A Changes: 1. Restore max UDP connection to 5 by remove private VMD encoder 2. Change the MIB file to V2.2	None
2.0	Build 14010310	N/A	VPort P06-1MP-M12 series	1. Web user interface is changed due to support the Profile S 2. Camera tamper will disabled if all video stream.	Bugs Fixed: N/A Changes: N/A	N/A



Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/Enhancements	Bugs Fixed/Changes	Note
1.4	Build 14030518	N/A	VPort P06-1MP-M12 series	New Features: N/A  Enhancements: 1. Support RTCP for RTSP stream 2. Remove TI SEI information from VPort's stream 3. Disable rshd & rlogin for security issue 4. Add an advanced frames-released algorighm to prevent cache-buffer full 5. Support MIB-II interfaces: ifNumber 6. List system log from latest to oldest 7. Modify "WEN" to "WED" on web Schedule page 8. Allow characters as '@', '.', '_', '-' for SMTP user account 9. Main page shows Host name, instead of model name 10. Support IE10 and above 11. Show video stream on non-IE browsers 12. Prevent crashing web server from taking over-sized snapshot jpeg image 13. The default setting of event alarm is enable 14. Show a warning message in upgrade process, which is "Firmware is upgrading, please don'tpower off the device before the system reboot is completed!"	Bugs Fixed:  1. Fix the issue of configuration import and firmware upgade were failed in HTTPS Mode  2. Fix the issue of failing in audio streaming occasionally via Multicast push protocol  3. Fix the issue of long learning time of Tamper alarm  4. Fix the issue of failed transmission of Multcast connection if IP address has been changed in DHCP mode  5. Fix the issue of the reconnecting requirement of the camera for activating the CBRPro setting  6. Fix the issue of inability of saving the account privileges  7. Fix the issue of interference between the VMD events  8. Fix the issue of inability of configuration file import via HTTPS in IE10  9. Fix the issue of no video stream when video port is in odd number  10. Fix the issue of inability of firware upgrade via Chrome  11. Fix the issue of inability of DynaStream previewing occasionally	N/A
1.3	N/A	N/A	VPort P06-1MP-M12 series	New Features: 1.IE10 supported 2.Force I after configuring unicast connection 3.Sequential snapshot function 4.Add the time interval parameters in NTP server time synchronization  Enhancements: 1. Fix the issues that different devices may have chance getting the same IP	Bugs Fixed: N/A Changes: N/A	N/A



Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/Enhancements	Bugs Fixed/Changes	Note
1.1	N/A	N/A	VPort P06-1MP-M12 series	2.Motion block of video motion detection	Bugs Fixed:  1. Fix the issue of reset button not in work  Changes: N/A	N/A
1.0	N/A	N/A	VPort P06-1MP-M12 series	Newly released for VPort 06 series  Enhancements:	Bugs Fixed: N/A Changes: N/A	N/A